

Identified Areas


- IA-1 Footprint of the former pottery facility.
- IA-2 Waste accumulation/storage area.
- IA-3 Loading dock.

Notes

- 1) 2 foot ground surface contours are from 2005.
- 2) Aerial Image is a 1 Foot MrSID County Mosaic dated Spring 2014 from OGRIP.
- 3) All Results and Standards Reported in mg/kg or ppm.
- 4) Highlighted samples exceed C/I standards.

Legend

- 29 Street Address
- Subject Property
- Identified Area
- Proposed Excavation Area
- Area requires further delineation sampling and analyses
- Soil Boring
- Monitoring Well/Soil Boring
- Shallow Soil Sample
- TCLP Sample
- VAP Generic Direct Contact Standards-
- C/I Commercial/Industrial
- C/E Construction/Excavation
- (0-2') Sample Depth

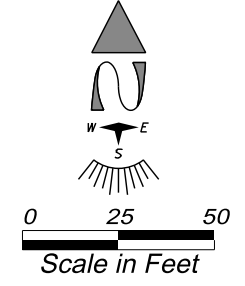

B-13 (0-2') NOVEMBER 9, 2006			
ANALYTE	RESULT	C/I	C/E
Lead	2,500	800	400

SS-29 (0-2') MAY 17, 2007			
ANALYTE	RESULT	C/I	C/E
Lead	10,300	800	400

B-12 (0-2') NOVEMBER 9, 2006			
ANALYTE	RESULT	C/I	C/E
Lead	15,400	800	400

B-12 (8-10') NOVEMBER 9, 2006			
ANALYTE	RESULT	C/I	C/E
Lead	2,230	800	400

SS-6A (0-2') AUGUST 16, 2006			
ANALYTE	RESULT	C/I	C/E
Lead	22,800	800	400

SS-32 (0-2') JULY 23, 2007			
ANALYTE	RESULT	C/I	C/E
Lead	11,000	800	400

SS-33 (0-2') JULY 23, 2007			
ANALYTE	RESULT	C/I	C/E
Lead	38,000	800	400

SS-23 (0-2') APRIL 18, 2007			
ANALYTE	RESULT	C/I	C/E
Lead	4,470	800	400

SS-23 (2-4') APRIL 18, 2007			
ANALYTE	RESULT	C/I	C/E
Lead	18,900	800	400

SS-47 (0-2') MARCH 14, 2018			
ANALYTE	RESULT	C/I	C/E
Lead	41,100	800	400

SS-34 (0-2') JULY 23, 2007			
ANALYTE	RESULT	C/I	C/E
Lead	1,900	800	400

SS-36 (0-2') JULY 23, 2007			
ANALYTE	RESULT	C/I	C/E
Lead	2,200	800	400

BROWNFIELD RESTORATION GROUP, LLC
 1000 S. Cleveland-Massillon Rd.
 Suite 106
 Akron, OH 44333
 Phone: (330) 668-4600
 Fax (330) 668-8464

Figure 16 - Proposed Soil Excavation (0-2 Feet)

Former Ungemach Pottery - 26 Potters Lane/
 16 Main Street, Roseville, Muskingum County, Ohio